


# Washers

## DIN 6340

for clamping fixtures

Bare steel

for thread dia.	d in mm	d <sub>1</sub> in mm	s in mm	Bare steel Art. No.	P. Qty.
M 8	8.4	23	4	<b>0495 8</b>	100
M 10	10.5	28	4	<b>0495 10</b>	
M 12	13	35	5	<b>0495 12</b>	
M 16	17	45	6	<b>0495 16</b>	
M 20	21	50	6	<b>0495 20</b>	
M 24	25	60	8	<b>0495 24</b>	50

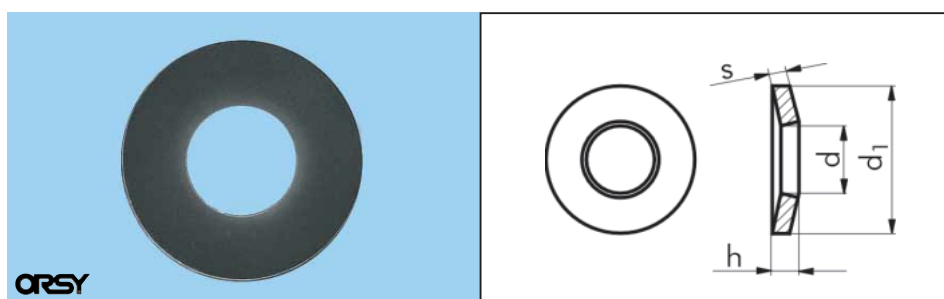


# Tensioning Washers

accord. to DIN 6796

Spring steel C 60,  
mechanically galvanised

for thread dia.	d in mm	d <sub>1</sub> in mm	h in mm	s in mm	mech. galvanised Art. no.	P. Qty.
3	3.2	7	0.85	0.6	<b>0413 13</b>	500
4	4.3	9	1.3	1.0	<b>0413 14</b>	
5	5.3	11	1.55	1.2	<b>0413 15</b>	
6	6.4	14	2.0	1.5	<b>0413 16</b>	
8	8.4	18	2.6	2.0	<b>0413 18</b>	100/500
10	10.5	23	3.2	2.5	<b>0413 110</b>	
12	13.5	29	3.95	3.0	<b>0413 112</b>	
14	15.0	35	4.65	3.5	<b>0413 114</b>	100
16	17.0	39	5.25	4.0	<b>0413 116</b>	

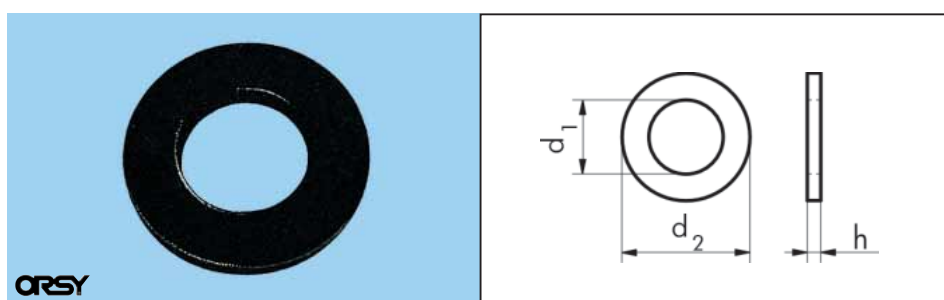

# Washers

## DIN 7349

for screws with heavy  
clamping sleeves

Bare steel

Galvanised steel, blue passivated

for thread dia.	d <sub>1</sub> in mm	d <sub>2</sub> in mm	s in mm	Bare steel Art. No.	P. Qty.	Galv. steel, blue pass. Art. No.	P. Qty.
M 5	5.3	15	2	<b>0497 5</b>	100		100
M 6	6.4	17	3	<b>0497 6</b>		<b>0497 06</b>	
M 8	8.4	21	4	<b>0497 8</b>		<b>0497 08</b>	
M 10	10.5	25	4	<b>0497 10</b>		<b>0497 010</b>	
M 12	13	30	5	<b>0497 12</b>		<b>0497 012</b>	
M 14	15	36	6			<b>0497 014</b>	50/100
M 16	17	40	6	<b>0497 16</b>		<b>0497 016</b>	100
M 18	19	44	8	<b>0497 18</b>			
M 20	21	44	8	<b>0497 20</b>	50	<b>0497 020</b>	100